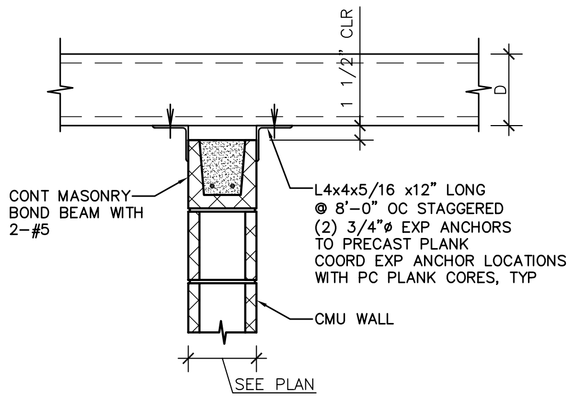

4 PRECAST PLANK AT NON–BEARING CMU WALL
SCALE: 1"=1'–0"

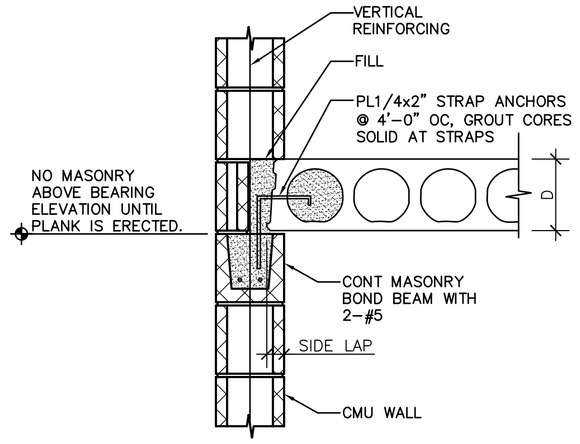

3 PRECAST PLANK
SCALE: 1"=1'–0"

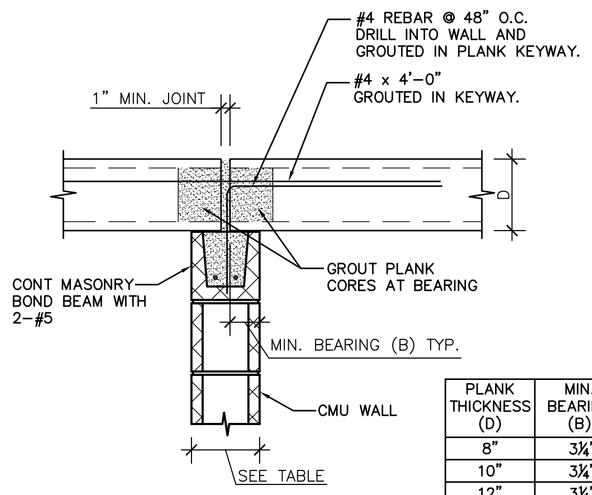

PLANK THICKNESS (D)	MIN. BEARING (B)	MIN. WALL THICKNESS (T)
8"	3¼"	8"
10"	3¼"	8"
12"	3¼"	8"
16"	4½"	10"

2 PRECAST PLANK BEARING ON CMU WALL
SCALE: 1"=1'–0"

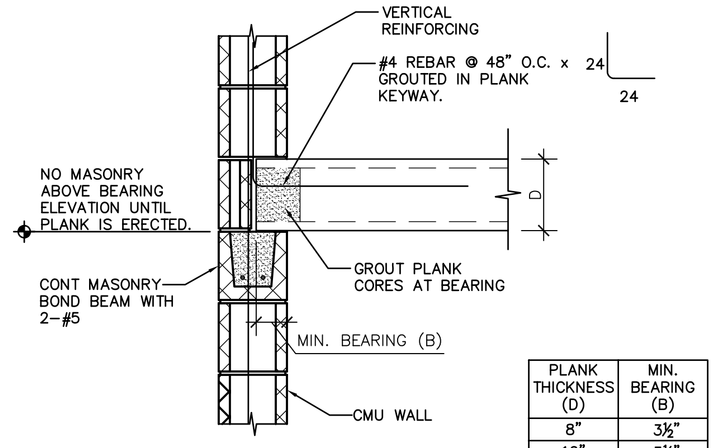

PLANK THICKNESS (D)	MIN. BEARING (B)
8"	3½"
10"	3½"
12"	3½"
16"	5"

1 PRECAST PLANK BEARING ON CMU WALL
SCALE: 1"=1'–0"

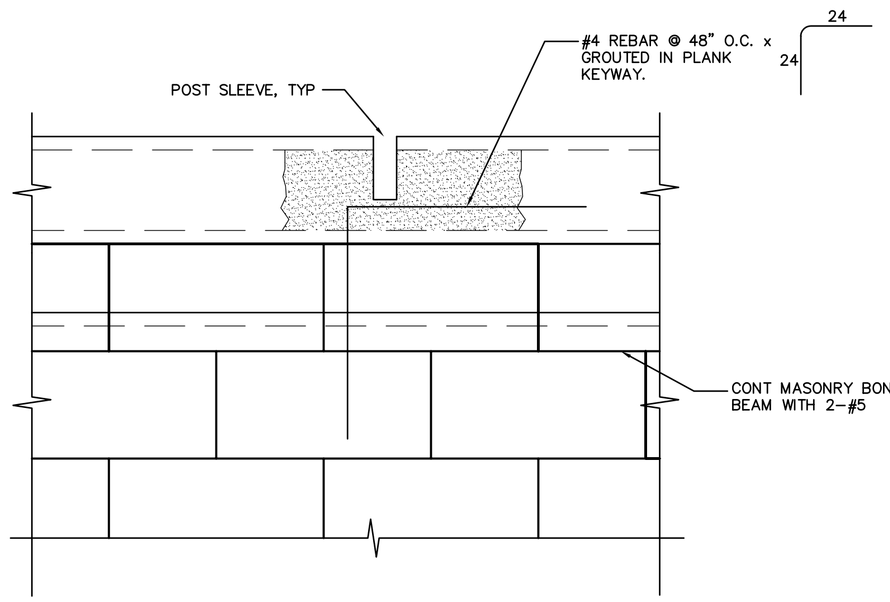

6 PRECAST PLANK BEARING WITH POST SLEEVE DETAIL
SCALE: 1 1/2"=1'–0"

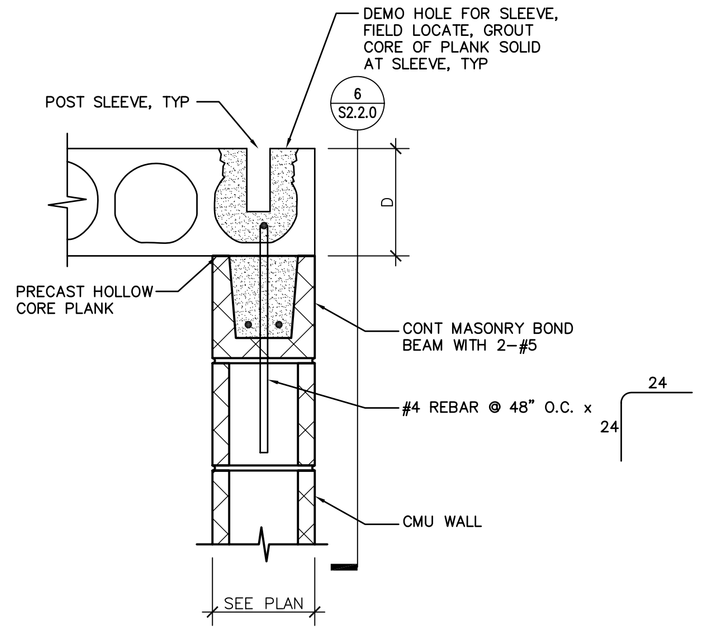

5 PRECAST PLANK BEARING WITH POST SLEEVE DETAIL
SCALE: 1 1/2"=1'–0"

ACCURATE Auto Carriers, Inc.
TRUCK & REPAIR, INC.

FES GROUP
Facility Engineering Services
28036 Oakland Oaks Ct.
Wixom, MI 48393
Phone: (248) 344-2800
Fax: (248) 344-1650
Web: www.fesgroupllc.com

•	BIDS	• 03/23/09
•	95% REVIEW	• 02/02/09

Pkg.: Issued For: Date:

Accurate Auto Carriers
Maintenance Facility

In Charge:
Designed: CAS
Drawn: KMK
Checked: CAS
Approved: CAS Date: 03/19/09

Sheet Title:
PRECAST SECTIONS
AND DETAILS

Job Number: MI–08060
Sheet Number: **S2.2.0**